
		NTSB ID: DEN01FA113		Aircraft Registration Number: N187AF	
		Occurrence Date: 06/10/2001		Most Critical Injury: Fatal	
		Occurrence Type: Accident		Investigated By: NTSB	
Location/Time					
Nearest City/Place Cerrillos	State NM	Zip Code 87010	Local Time 1221	Time Zone MDT	
Airport Proximity: Off Airport/Airstrip		Distance From Landing Facility:			
Aircraft Information Summary					
Aircraft Manufacturer Mitsubishi		Model/Series MU-2B-20		Type of Aircraft Airplane	
Revenue Sightseeing Flight: No			Air Medical Transport Flight: No		
Narrative					
Brief narrative statement of facts, conditions and circumstances pertinent to the accident/incident:					
HISTORY OF FLIGHT					
<p>On June 10, 2001, at 1221 mountain daylight time, a Mitsubishi MU-2B-20, N187AF, registered to and operated by the pilot, was destroyed when it impacted terrain in an uncontrolled descent near Cerrillos, New Mexico. The private pilot and one passenger were fatally injured. Visual meteorological conditions prevailed, and an instrument flight rules (IFR) flight plan had been filed for the personal flight being conducted under Title 14 Code of Federal Regulations (CFR) Part 91. The flight originated in Peoria, Illinois, approximately 0945 central daylight time.</p>					
<p>North Point Aviation, Inc., records indicated that on the morning of the accident, the pilot used his personal key to unlock a fuel pump. The airplane was serviced to capacity with 190 gallons of Jet-A fuel. The pilot then telephoned the Kankakee, Illinois, Automated Flight Service Station (AFSS), obtained a standard weather briefing, and filed an IFR flight plan to Santa Fe. The airplane was seen to take off from the Mount Hawley Auxiliary Airport (3MY) between 0930 and 0945 central daylight time. According to a family member, the pilot and his wife were traveling to Santa Fe to celebrate their wedding anniversary.</p>					
<p>According to the Federal Aviation Administration (FAA), when the pilot arrived in the Santa Fe area, the Albuquerque Air Route Traffic Control Center (ARTCC) instructed him to enter a holding pattern due to conflicting traffic. He then cancelled his IFR flight plan and was told to contact the Santa Fe tower. An unofficial transcript of radio communications was prepared. Approximately 1218, the pilot contacted the control tower and reported he was 4 miles from the Santa Fe VORTAC. Shortly thereafter, he reported he was 2 miles from the VORTAC. At 1220, the pilot said he was "just going to do a three sixty out here south of the V-O-R and turn around and come back in." This was the last significant transmission from the pilot.</p>					
<p>There were several witnesses to the accident, and the following is based on written statements, interviews and telephone conversations. Witness #1 was driving a tractor in the village of Cerrillos. He looked up and saw an airplane, north of the village, "do a couple of motions," then it "headed nose down towards the ground." He said the wings appeared to be "rocking back and forth." Being a volunteer fireman, he responded to the accident site with the fire department after calling 9-1-1 and reporting the accident. Witness #2 was walking near his home when an airplane appeared about 40 to 50 degrees above the horizon. It made an "irregular" sound, "like he was going up and down," and the airplane came down steeply in a right (clockwise) spin. He said both engines were operating, and he attributed the irregular sound he heard "to the change of the sound while it was spinning." Witness #3 was driving north and was approximately 1/2-mile south of Cerrillos when he saw an airplane "going straight down and spinning in a clockwise motion." Three other witnesses were interviewed and their observations were similar.</p>					
<p>Witness #4, a Continental Airlines captain, was flying his personal airplane from Aztec, New</p>					

 <p>National Transportation Safety Board FACTUAL REPORT AVIATION</p>	NTSB ID: DEN01FA113
	Occurrence Date: 06/10/2001
	Occurrence Type: Accident

Narrative (Continued)

Mexico, to Alpine, Wyoming. When he was 20 miles southeast of the Santa Fe VORTAC (Very high frequency Omnidirectional Radio range, TACTical air navigation), he noticed "a large black vertical plume of smoke." Albuquerque ARTCC requested that he proceed to the area. He circled the accident site and advised them of the burning wreckage. He said he did not hear any distress call.

According to the New Mexico State Police, the first 9-1-1 call was received at 1223. The accident occurred during the hours of daylight at a GPS (Global Positioning System) location of 35 degrees, 27'33.6" north latitude, and 106 degrees, 06'28.5" west longitude. The accident site was 9.57 miles from the Santa Fe Airport on the 175 degree bearing.

PERSONNEL INFORMATION

The pilot, age 58, an orthodontist, held a private pilot certificate, dated June 20, 1999, with airplane single/multiengine land and instrument ratings. He also held a third class airman medical certificate, dated July 31, 2000, containing the restriction, "Must wear corrective lenses for near and distant vision," along with a waiver for amblyopia.

The pilot's flight logbook was not located during the investigation and documentation of a biennial flight review was not found. However, the multiengine rating, the most recent activity recorded by FAA, was added to the pilot's certificate on June 20, 1999. The practical test was taken in a Beech 95A. According to his application for medical certification, the pilot estimated he had logged 800 total flight hours, of which 100 hours were accrued in the previous six months.

According to N187AF's previous owner in Aiken, South Carolina, the pilot traded his Cessna 414 as a down payment on the MU-2B on April 27, 2001. He attended initial MU-2 training at Howell Enterprises in Smyrna, Tennessee, but was unable to complete the course when he could not obtain insurance on the airplane. Howell Enterprises referred him to a private MU-2 flight instructor in Dickson, Tennessee. The instructor flew with the pilot and family members from Peoria, Illinois, to Lake Placid, New York, and back. According to friends and business associates, the pilot was told not to make the accident trip on at least four different occasions during the week preceding the accident. The flight instructor also told the pilot twice not to go. Estimated dual instruction time that the pilot received in the airplane was 4 hours.

AIRCRAFT INFORMATION

N187AF (s/n 187), an MU-2B-20 (-20 denotes a short bodied airplane), also known as the MU-2F, was manufactured by Mitsubishi Heavy Industries of Japan in 1969. It was equipped with two Garrett (Honeywell) TPE-331-1-151A turboprop engines (s/n P92163C, left; P92164C, right), each rated at 705 eshp (equivalent shaft horsepower), and two Hartzell HC-B3TN-5E propellers (non-counter rotating) with T10178B-11R blades. Each propeller assembly consisted of three all-metal, hydraulically operated, constant speed blades, with full feathering and reversing (Beta) capabilities.

The airplane maintenance records were not located during the investigation.

METEOROLOGICAL INFORMATION

The following METARS (Aviation Routine Weather Report) were recorded at Santa Fe Municipal Airport:

1153: Wind, 200 degrees at 8 knots; visibility, 10 statute miles; sky condition, clear; temperature, 29 degrees C. (84 degrees F.); dew point, -2 degrees C. (28 degrees F.); altimeter setting, 30.17 inches of mercury.

1253: Wind, 250 degrees at 10 knots, gusts to 17 knots; visibility, 10 statute miles; sky condition, clear; temperature, 31 degrees C. (88 degrees F.); dew point, -2 degrees C. (28 degrees F.); altimeter setting, 30.15 inches of mercury.

National Transportation Safety Board

FACTUAL REPORT

AVIATION

NTSB ID: DEN01FA113

Occurrence Date: 06/10/2001

Occurrence Type: Accident

Narrative (Continued)

WRECKAGE AND IMPACT INFORMATION

The airplane impacted hilly terrain on a magnetic heading of 200 degrees at a GPS elevation of 6,146 feet msl (above mean sea level). The airplane wreckage was confined to a relatively small area, and was almost completely consumed by an intense ground fire.

The left wing leading edge was crushed rearward to the rear spar. The left aileron trim actuator measured 3.5 inches. The upper surface of the right wing was melted between the fuselage and engine nacelle. The right aileron trim actuator measured 2.5 inches. The traveling nut on the attached right wing flap jackscrew and on the separated left wing flap jackscrew were both measured to be 1.5 inches from the aft bearing housing. According to the manufacturer, this equates to 20 degrees flaps down, or an approach/landing flap setting. The vertical stabilizer and rudder were aligned on a magnetic heading of 193 degrees and were on top of the right horizontal stabilizer and elevator. The left horizontal stabilizer and elevator had been consumed by fire. The elevator trim actuator was extended 1-7/8 inches, and the rudder trim actuator was extended 7.0 inches. The left tip tank and flap separated from the wing and were found in a gully approximately 50 feet northeast of the impact point. The right tip tank separated from the wing and was located approximately 20 feet northwest of the impact point on a small hill. Crush lines on the right tip tank measured approximately 45 degrees. The landing gear was retracted. The swaged ends of the flight control cables were intact and found in the vicinity of the destroyed flight control wheels and rudder pedals.

Both engines were disrupted and exposed internal parts. Rotational scoring of the curvic couplings was noted, and the interlocking teeth were meshed. Metal splatter could be seen on the turbine discs and stators. The left and right power levers were in the FLIGHT IDLE and TAKEOFF positions, respectively. The position of the condition levers could not be determined.

Both propeller assemblies were separated from their respective engines. The left propeller blades bore chordwise scratches on the cambered surfaces and leading edge gouges. One blade was curled. The right propeller blades bore leading edge gouges, and the black paint on the cambered surfaces had been polished off. All of the blades were twisted toward a low pitch setting. One blade was fractured 6 inches from the tip.

MEDICAL AND PATHOLOGICAL INFORMATION


An autopsy was performed on the pilot by the New Mexico State Medical Examiner's Office in Albuquerque. Toxicological protocols were conducted by both the New Mexico State Medical Examiner's Office and FAA's Civil Aeromedical Institute (CAMI). Neither report indicated the presence of ethanol or drugs. Tests for carbon monoxide and cyanide could not be performed.

TESTS AND RESEARCH

On July 19 and 20, the engines and propellers were disassembled and inspected by Honeywell Engines at their facility in Phoenix, Arizona, under the direction of the National Transportation Safety Board. A Federal Aviation Administration aviation safety inspector was also in attendance. According to Honeywell's report, "the type and degree of damage was indicative of engine rotation and operation at the time of impact with the ground. No pre-existing condition was found on either engine that would have interfered with normal operation."

According to Hartzell's report, "Both propellers had power on at the time of impact. No estimate of the preimpact blade angle or amount of power could be made. There were no propeller discrepancies noted that could have precluded normal operation. All damage was consistent with impact damage."

National Track Analysis Program (NTAP) data was obtained from the Albuquerque ARTCC. According to

 <p>National Transportation Safety Board FACTUAL REPORT AVIATION</p>	NTSB ID: DEN01FA113
	Occurrence Date: 06/10/2001
	Occurrence Type: Accident

Narrative (Continued)

this data, between 1217:17 and 1220:41, the airplane gradually slowed from 231 knots to 200 knots and descended from 14,300 feet to 11,760 feet. Then, between 1220:41 and 1220:47 (6 seconds), groundspeed dropped 31 knots, from 200 knots to 169 knots, and altitude dropped 440 feet, from 11,760 feet to 11,320 feet (4,400 feet per minute). Between 1220:47 and 1220:53 (6 seconds), groundspeed dropped another 31 knots, from 169 knots to 138 knots, and altitude dropped 1,020 feet, from 11,320 feet to 10,300 feet (10,200 feet per minute). According to the MU-2B Airplane Flight Manual, the stall speed varies between 72 and 85 knots, depending on airplane weight, and between 85 and 120 knots, depending on the angle of bank, with flaps deployed 20 degrees. The airplane, according to the radar data, was above stall speed.


Denver ARTCC's Quality Assurance Division was asked to examine the radar data. The data, in ASCII format, was loaded into Tactical Mapping Software. Aircraft position was depicted using latitude/longitude plots in time sequence. Speed information was then obtained by mathematical calculation of distance traveled. The data can then be animated independently or synchronized with IRIG-B audio data and viewed in three dimensions. Three dimensional viewing was accomplished by utilizing U.S. Geographic Survey elevation data, and can be viewed from any angle. According to their results, between 1220:47 and 1220:53, when the altitude dropped from 11,320 feet to 10,300 feet, the computed descent angle was 33.9 degrees (margin of error + or - 4 degrees). Between that last position and the GPS-derived point of impact, the descent angle was 29 degrees (minimum).


FAA has noted several cases where turboprop pilots have either inadvertently or intentionally positioned the power levers over the flight idle gate while in flight, usually to decelerate and/or lose altitude rapidly, or they may not have appreciated the consequences of their actions. As a result, a series of Airworthiness Directives (A.D.s) were issued in 1997. A.D. 97-25-02 was one of these and affected all MU-2B models. It required the insertion of the following statement into Airplane Flight Manuals (AFMs): "Positioning of power levers below the flight idle stop while the airplane is in flight is prohibited. Such positioning may lead to loss of airplane control or may result in an over speed condition and consequent loss of engine power." This wording was incorporated into the "Limitations" section of the MU-2B-20 AFM by revision in March 1998.

ADDITIONAL INFORMATION

In addition to the Federal Aviation Administration, parties to the investigation included Mitsubishi Heavy Industries of America and Honeywell (Garrett engines).

The wreckage was released to the executor of the pilot's estate on October 18, 2001.

 National Transportation Safety Board FACTUAL REPORT AVIATION		NTSB ID: DEN01FA113				
		Occurrence Date: 06/10/2001				
		Occurrence Type: Accident				
Landing Facility/Approach Information						
Airport Name Santa Fe Municipal		Airport ID: SAF	Airport Elevation 6348 Ft. MSL	Runway Used	Runway Length	Runway Width
Runway Surface Type: Unknown						
Runway Surface Condition: Unknown						
Approach/Arrival Flown: NONE						
VFR Approach/Landing: Unknown						
Aircraft Information						
Aircraft Manufacturer Mitsubishi		Model/Series MU-2B-20		Serial Number 187		
Airworthiness Certificate(s): Normal						
Landing Gear Type: Retractable - Tricycle						
Amateur Built Acft? No		Number of Seats: 9		Certified Max Gross Wt. 9920 LBS		Number of Engines: 2
Engine Type: Turbo Prop		Engine Manufacturer: Garrett		Model/Series: TPE331-1-151A		Rated Power: 705 HP
- Aircraft Inspection Information						
Type of Last Inspection		Date of Last Inspection	Time Since Last Inspection Hours		Airframe Total Time 6500 Hours	
- Emergency Locator Transmitter (ELT) Information						
ELT Installed?/Type		ELT Operated?	ELT Aided in Locating Accident Site?			
Owner/Operator Information						
Registered Aircraft Owner John M. White		Street Address 1215 N. North St.				
		City Peoria		State IL	Zip Code 616061533	
Operator of Aircraft John M. White		Street Address 1215 N. North St.				
		City Peoria		State IL	Zip Code 616061533	
Operator Does Business As:			Operator Designator Code:			
- Type of U.S. Certificate(s) Held: None						
Air Carrier Operating Certificate(s):						
Operating Certificate:			Operator Certificate:			
Regulation Flight Conducted Under: Part 91: General Aviation						
Type of Flight Operation Conducted: Personal						

 <p>National Transportation Safety Board FACTUAL REPORT AVIATION</p>	NTSB ID: DEN01FA113
	Occurrence Date: 06/10/2001
	Occurrence Type: Accident

First Pilot Information

Name On File	City On File	State On File	Date of Birth On File	Age 58
-----------------	-----------------	------------------	--------------------------	-----------

Sex: M	Seat Occupied: Left	Occupational Pilot? Doctor/Dentist	Certificate Number: On File
--------	---------------------	------------------------------------	-----------------------------

Certificate(s): Private

Airplane Rating(s): Multi-engine Land; Single-engine Land

Rotorcraft/Glider/LTA: None

Instrument Rating(s): Airplane

Instructor Rating(s): None

Current Biennial Flight Review? 06/1999

Medical Cert.: Class 3	Medical Cert. Status: Valid Medical--w/ waivers/lim.	Date of Last Medical Exam: 07/2000
------------------------	--	------------------------------------

- Flight Time Matrix	All A/C	This Make and Model	Airplane Single Engine	Airplane Multi-Engine	Night	Instrument		Rotorcraft	Glider	Lighter Than Air
						Actual	Simulated			
Total Time	800	4								
Pilot In Command(PIC)										
Instructor										
Instruction Received										
Last 90 Days	50	4								
Last 30 Days										
Last 24 Hours										

Seatbelt Used?	Shoulder Harness Used?	Toxicology Performed? Yes	Second Pilot? No
----------------	------------------------	---------------------------	------------------

Flight Plan/Itinerary

Type of Flight Plan Filed: IFR

Departure Point Peoria	State IL	Airport Identifier 3MY	Departure Time 0945	Time Zone UTC
---------------------------	-------------	---------------------------	------------------------	------------------

Destination Santa Fe	State NM	Airport Identifier SAF	
-------------------------	-------------	---------------------------	--


Type of Clearance: None

Type of Airspace: Class E

Weather Information

Source of Wx Information:


Unknown

 <p>National Transportation Safety Board FACTUAL REPORT AVIATION</p>	NTSB ID: DEN01FA113
	Occurrence Date: 06/10/2001
	Occurrence Type: Accident

Weather Information					
WOF ID	Observation Time	Time Zone	WOF Elevation	WOF Distance From Accident Site	Direction From Accident Site
SAF	1153	MDT	6348 Ft. MSL	NM	Deg. Mag.
Sky/Lowest Cloud Condition: Clear			Ft. AGL	Condition of Light: Day	
Lowest Ceiling: None		Ft. AGL	Visibility: 10	SM	Altimeter: 30.17 "Hg
Temperature: 29 °C	Dew Point: -2 °C	Weather Conditions at Accident Site: Visual Conditions			
Wind Direction: 200		Wind Speed: 8	Wind Gusts:		
Visibility (RVR):	Ft.	Visibility (RVV)	SM		
Precip and/or Obscuration:					

Accident Information		
Aircraft Damage: Destroyed	Aircraft Fire: Ground	Aircraft Explosion: None

- Injury Summary Matrix	Fatal	Serious	Minor	None	TOTAL
First Pilot	1				1
Second Pilot					
Student Pilot					
Flight Instructor					
Check Pilot					
Flight Engineer					
Cabin Attendants					
Other Crew					
Passengers	1				1
- TOTAL ABOARD -	2				2
Other Ground					
- GRAND TOTAL -	2				2

 National Transportation Safety Board FACTUAL REPORT AVIATION	NTSB ID: DEN01FA113	
	Occurrence Date: 06/10/2001	
	Occurrence Type: Accident	

Administrative Information

Investigator-In-Charge (IIC)
Arnold W. Scott

Additional Persons Participating in This Accident/Incident Investigation: