


BADAMI (AK78) (PABP) 29 E N70°08.25' W147°01.83' UTC-9(-8DT) **POINT BARROW**
 PVT 26 L4 51(GVL) 03-21 **H-1A, L-4J**
AIRPORT REMARKS—Unattended.
COMMUNICATIONS—(CTAF 122.9) (TIE-IN FSS DEADHORSE SCC 1500-0630Z± OT CTC FAIRBANKS FSS)
RADIO/NAV/WEATHER REMARKS—For a local call to Deadhorse FSS dial 659-2401. For a toll free call to Fairbanks FSS dial 1-866-248-6516.

§ DEADHORSE (SCC) (PASC) 0 SE N70°11.69' W148°27.91' UTC-9(-8DT) **POINT BARROW**
 P 65 BL5, 6, 8, 9①, 11 H65(ASP) 05-23 S108, T200, TT370 **H-1A, L-4J**
FUEL—(NC-100, B, MOGAS) **IAP**

AIRPORT REMARKS—Attended 1600-0230Z±. Migratory waterfowl in vicinity of arpt Spring through Fall. Caribou occasionally on rwy and movement areas. Snow/ice removal and arpt hazardous reporting performed and valid during duty hrs contact arpt manager at 907-659-2553 or fax 907-659-2216. Rwy condition reports reflect conditions during duty hrs only. Class I, ARFF Index B. CLOSED to air carrier operations with more than 30 passenger seats except with PPR in writing to Airport Manager, Pouch 340002, Prudhoe Bay, AK 99734. Rwy 05-23 500' rwy safety area each end of rwy. Twy F closed to aircraft 12,500 lbs and over. Rwy 05 rgt t/c. Fuel avbl on 123.0. Arpt sand larger gradation than FAA recommended/see AC150/5200-30. Rwy 23 RVR touchdown avbl. HIRL Rwy 05-23 oper low ints continuously and MALSR Rwys 05 and 23 ops continuously. To increase ints ctc Deadhorse FSS 123.6. When FSS clsd ACTIVATE HIRL Rwy 05-23 and MALSR Rwys 05 and 23—CTAF. ①Rwy 05, TCH 50'. GS 3.0°. Rwy 23, TCH 51'. GS 3.0°.

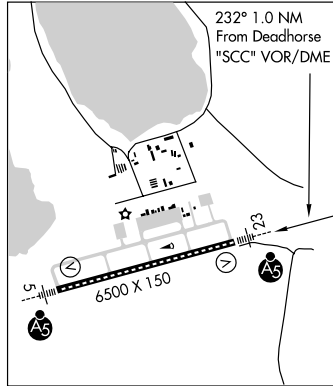

WEATHER DATA SOURCES—(ASOS 907-659-2591).
COMMUNICATIONS—(CTAF 123.6) (UNICOM 123.0)(ATIS 118.4) (TIE-IN FSS DEADHORSE SCC 1500-0630Z±-NOTAM SCC OT CTC FAIRBANKS FAI)
RADIO—123.6 122.2 (V) (LAA 123.6)
ANCHORAGE CENTER APP/DEP CON—370.9 134.4

RADIO AIDS TO NAVIGATION
 (H)VOR/DME 113.9 SCC Chan 86 N70°11.95' W148°24.97' 232° 1.0 NM to fld. 76/23E.
 PUT RIVER NDB(HW) 376 PVQ N70°13.36' W148°24.97' 188° 2.0 NM to fld./23E.
VHF/DF—Ctc DEADHORSE FSS.
ILS/DME 109.3 I-SCC Chan 30 Rwy 05. LOC back course unusable byd 20° right of course.

RADIO/NAV/WEATHER REMARKS—Local call to Deadhorse FSS dial 659-2401. For a toll free call to Fairbanks FSS dial 1-866-248-6516. Contract wx observer is avbl when Deadhorse FSS clsd on 133.55 or phone 907-659-2401.

HELMERICKS (22AK) 0 N N70°24.98' W150°22.19' UTC-9(-8DT) **POINT BARROW**
 PVT 5 25(EARTH) 03-21
AIRPORT REMARKS—Unattended. Ditches along each side of rwy. 100LL for emerg use only. Rwy 03-21 soft when wet. Ldg fee.
COMMUNICATIONS—(CTAF 122.9) (TIE-IN FSS DEADHORSE SCC 1500-0630Z± OT CTC FAIRBANKS FAI)
RADIO/NAV/WEATHER REMARKS—For a toll free call to Fairbanks FSS dial 1-866-248-6516.

INIGOK (4AK1) 96 W N70°00.23' W153°04.66' UTC-9(-8DT) **POINT BARROW**
 PVT 192 B5, 9①, 10 50(GVL) 02-20 **H-1A, L-4J**
AIRPORT REMARKS—Unattended. 18' antenna atop bldg 500' NW of Rwy 20. ①Rwy 02, TCH 40'. GS 3.0°. Rwy 20, TCH 40'. GS 3.0°.
COMMUNICATIONS—(CTAF 122.9) (TIE-IN FSS DEADHORSE SCC 1500-0630Z± OT CTC FAIRBANKS FAI)
RADIO/NAV/WEATHER REMARKS—Local call to Deadhorse FSS dial 659-2401. For a toll free call to Fairbanks FSS dial 1-866-248-6516.

DEAD TREE BC N53°21.00' W131°56.63' **KETCHIKAN**
 NDB(MHW) ZYP 248 118° 7.3 NM to Sandspit. /24E. **L-1D**